

RAPID ANALYSIS REPORT

Scientific Anatomy of the 26 August 2026 Bhotekoshi Flash Flood

IRDR Young Scientist's rapid analysis of the flash flood event

Contributors in Alphabetic Order: Basanta Raj Adhikari^{1,2}, Deepak Marahatta^{1,3}, Rita Thakuri^{1,4,8}, Sasmita Poudel^{1,5}, Suman Chapagain^{1,6}, Suraj Gautam^{1,7,8}

¹Young Scientist, Integrated Research on Disaster Risk, ²Institute of Engineering, Tribhuvan University, ³Disaster Education Promotion Office, ⁴National Society for Earthquake Technology, ⁵Helen Keller International, ⁶Practical Action, ⁷Institute of Himalayan Risk Reduction, ⁸IRDR ICoE

Reviewers: Peng Cui (IRDR Fellow), Saini Yang (IRDR Executive Director), Fang Lian (IRDR Science Officer)

Date and Time of Event	Report Status	Affected Districts
Wednesday, 26 August 2026 8:30 - 9:15 NST	22:00 PM 26 August 2026	Rasuwa, Nuwakot, Dhading, and Chitwan

EXECUTIVE SUMMARY

The 26 August 2026 Bhotekoshi flash flood appears to have been triggered by an ice, rock and soil mass failure around the Deding/Langtang region rather than intense localized rainfall. The failure likely blocked the river and formed a temporary natural dam for about 18-19 hours. The dam then breached around 8:30-8:37 a.m. on 26 August, releasing a large volume of water, ice, rock, sediment and debris. Continued inflow from the Mala River and other tributaries may have masked the upstream blockage. The steep gradient and narrow valley further accelerated and concentrated the flood, while the heavy debris load increased its destructive force.

The flood caused catastrophic human, physical and economic impacts along the Bhotekoshi-Trishuli corridor. It resulted in substantial loss of life and missing persons, destruction of settlements, customs and security facilities, extensive damage to roads and more than 30 bridges, disruption of Nepal-China border trade and tourism, severe communication outages, and major damage to hydropower and transmission infrastructure. Preliminary assessments indicate that about 748 MW of hydropower capacity was affected. The event demonstrates how a sudden upstream slope and ice failure can cascade into a highly destructive flood with widespread impacts far downstream.

Trigger Mechanisms

From the outset, available rainfall and river data showed no heavy or sufficiently localized rainfall capable of explaining the magnitude and sudden onset of the flood. This prompted a rapid investigation by the IHRR ICoE of the IRDR, involving IRDR Young Scientists from Nepal with support from scientists in China. Within a few hours, the team reviewed satellite observations, weather information and river data and identified a suspected slope-failure area around Deding in the Langtang region. Pre-event satellite observations also showed changes in snow and ice conditions around the suspected source area, including snow retreat and changes in snow accumulation. As pre-event and post-event satellite imagery became available, the suspected location closely matched the observed source area, supporting the initial assessment.



Image: Satellite image of the ice/rock avalanche location from 25 and 26 August 2026 (Source: Planet).

The combined analysis of satellite imagery, rainfall and discharge data indicates that the initial failure likely occurred around 1:00-2:00 p.m. on 25 August. A large ice-rock-soil mass likely descended from approximately 5,000 m toward the river at around 3,000 m, where it temporarily blocked the river and formed a natural dam. During the fall, the ice was likely broken into smaller pieces and mixed with soil, rock and debris. The blockage remained for approximately 18-19 hours, while water accumulated behind it. Some of the trapped ice may have melted during this period. While frozen ice may initially have helped hold the soil and debris together, its melting could have loosened the material, increased water infiltration and promoted internal erosion, progressively weakening the blockage. The analysis also identified mild rainfall within the Mala River watershed, which continuously contributes flow to the Bhotekoshi River from the west near the Nepal-China border. Continued inflow from the Mala River and other tributaries would have maintained downstream flow even while the upstream Bhotekoshi channel was blocked. This may have masked the effect of the blockage in downstream river conditions, making the developing

natural dam difficult to recognize from downstream. This interpretation is also supported by observations from Planet satellite imagery.


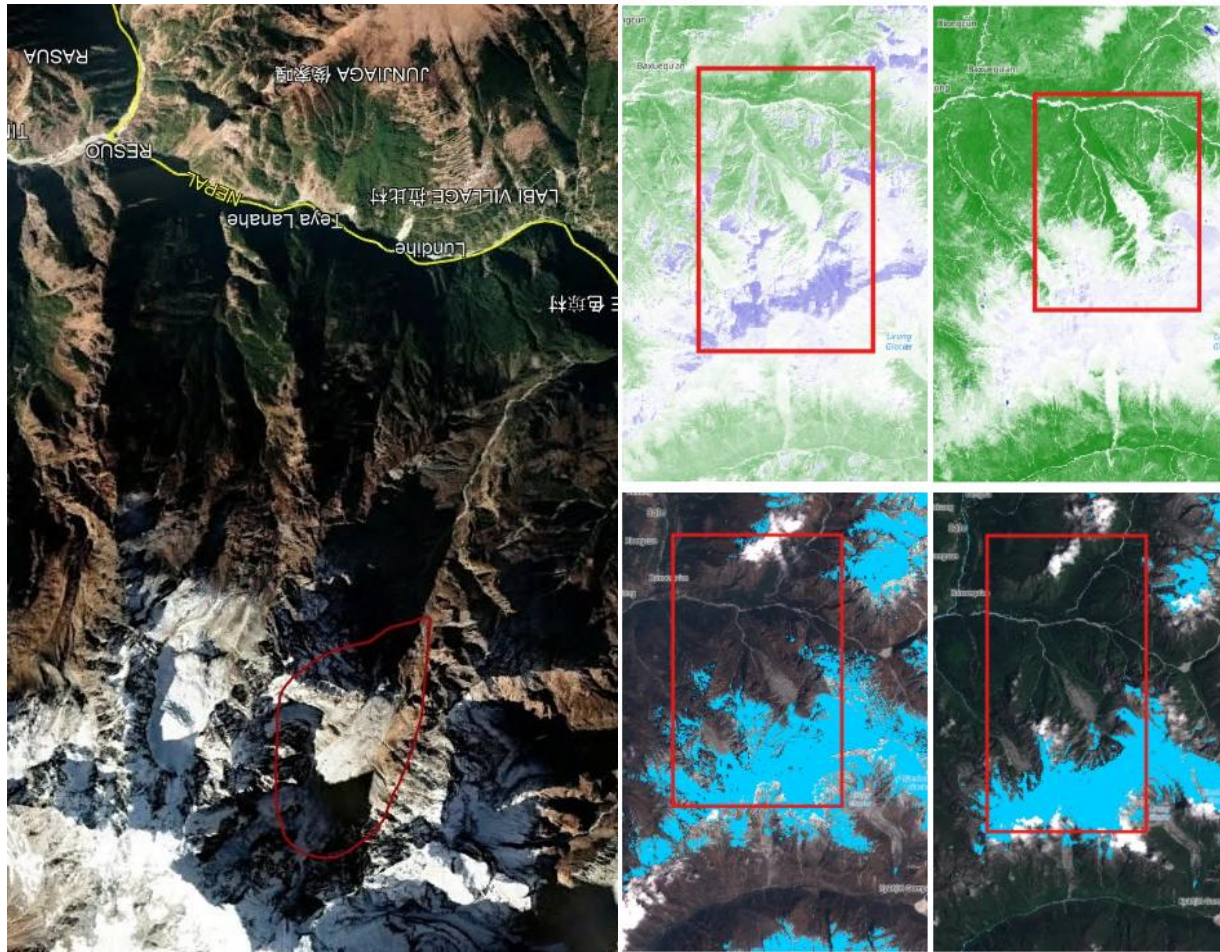


Image: Satellite image (left), normalized difference water index (top right), and normalized difference snow index (bottom right) from 12 March and 12 August (Source: Google Map and Copernicus, accessed at 11:00 AM, 26 August 2026).

The temporary dam likely breached around 8:30-8:37 a.m. on 26 August, releasing water, ice, rock, soil and sediment. A magnitude 4.4 earthquake was felt at around 8:37 a.m., while ground reports also described a massive sound or roar at about the same time. The close timing of these observations provides supporting evidence for a sudden dam breach around this period, although the exact relationship between the breach, seismic shaking and reported sound requires further confirmation.

The Bhotekoshi discharge station at Rasuwagadhi (Station Index No. 446.22) showed no clear increase immediately before the initial failure. This is consistent with the interpretation that the major flood was generated by the later breach rather than by a sudden rainfall-driven increase in flow. Several unusual features in the discharge record require further examination and are discussed in the downstream propagation section.

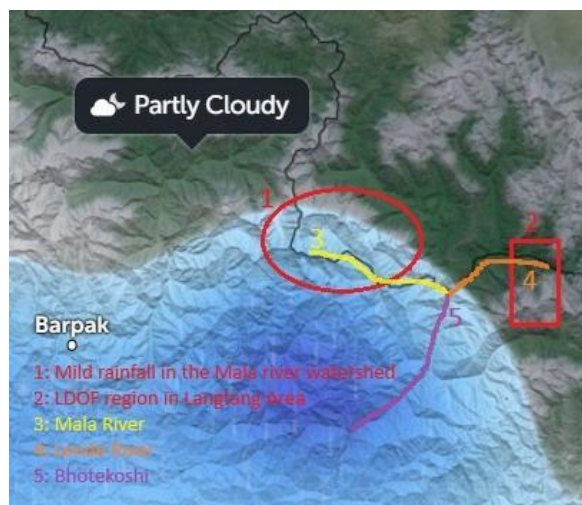

Hourly Discharge Measurement in Bhotekoshi River in Rasuwagadhi

Source: River Watch, DHM, 26 August 2026

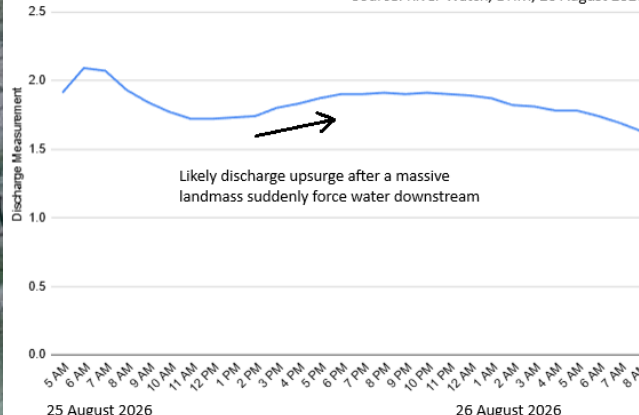


Image: Rainfall map for 25 August 2026 (left), and discharge measurement in the Bhotekoshi River in Rasuwagadhi (right) (Source: Department of Hydrology and Meteorology, Nepal).

Overall Chronology

Water & ice dynamics (Pre-event) Long-term environmental changes, water retreat, and increasing ice overburden in the northern Langtang region.	Ice/rock avalanche (1-2 pm, 25 Aug) A massive volume of ice, rock, and soil detached at around 5,000 m and rapidly descended to 3,000 m, fracturing and mixing during the descent.	Temporary dam formation (25 Aug, afternoon) The channel was blocked as the collapsed ice-rock-debris mass formed a natural impoundment dam, obstructing the flow.	Water impoundment (25-26 Aug) Water accumulated for 18–19 hours from existing river flows and melting ice, increasing lateral pressure on the temporary dam.	Sudden dam breach (~8:35 am, 26 Aug) Increasing lateral pressure, combined with ice melting within the debris and soil loosening and saturation, resulted in the dam breach, generating strong ground vibrations recorded as a 4.4-magnitude seismic event and an explosion-like sound.
--	---	--	---	--

Downstream Propagation

Following the estimated 8:30-8:37 a.m. breach on 26 August, a large volume of water, ice, rock, soil and sediment entered the Bhotekoshi River and moved rapidly downstream. The flood was reported at Rasuwagadhi at around 9:00 a.m., reached Timure at approximately 9:15 a.m., and reached Betrawati at around 9:20 a.m. These very short travel times indicate exceptionally rapid movement, particularly through the upper Bhotekoshi corridor.

Ground reports described people hearing a massive sound or roar as the flood moved through the valley. The steep terrain and narrow river corridor in the upper section concentrated the flood and limited its sideways spread, allowing it to maintain very high speed and destructive force. The large amount of rock, sediment, ice and debris carried by the flood further increased its destructive capacity.

Further downstream, the river corridor became wider, providing more space for the floodwater and debris to spread and reducing its speed and energy. By the evening, the flood had reached the southernmost areas of Nepal, but its velocity had largely returned to normal river-flow

conditions and much of its energy had dissipated. Consequently, comparatively limited additional damage was reported in these wider downstream areas.

Overall, the observed arrival times indicate a clear change in flood behaviour along the river: very rapid and highly destructive movement through the narrow upper valley, followed by progressively slower and more dispersed flow as the river corridor widened downstream.

Consequences

Note: This summary is based on reports published by government authorities and national media by the evening of the event day. The consequences are likely to be more extensive, and the figures may be updated by the government as further information becomes available. Readers are advised to refer to official government portals for the latest information.



Photo source: <https://www.onlinekhabar.com/2026/08/2003997/floods-damage-431-megawatt-power-plant>

The 26 August 2026 Bhotekoshi flash flood caused catastrophic human, physical, economic and service-related impacts along the Bhotekoshi-Trishuli corridor. The human toll increased substantially as search and rescue operations continued. By the evening of 26 August, 95 bodies had been recovered, while hundreds of people remained unaccounted for. The reported missing included security personnel, customs employees, hydropower workers, local residents, tourists, pilgrims and other travellers. Nepal Police reported 28 police personnel still out of contact, while 15 customs employees remained unaccounted for. In addition, approximately 60 people associated with the 20 MW Langtang Khola Hydropower Project were reported out of contact, including workers believed to be inside a tunnel. The Nepal Tourism Board had reported 384 tourists and travellers out of contact, including 291 foreign nationals and 93 Nepali nationals,

although later international reports cited higher figures that had not yet been reconciled with the official Nepal Tourism Board list. At least 63 injured survivors were subsequently receiving treatment or had been evacuated for medical care. The flood devastated Timure, Syabrubesi and other settlements along the upper Bhotekoshi corridor, destroying or severely damaging houses, markets, customs facilities, security posts, vehicles and other assets. The 42-km Betrawati-Rasuwadgaadi road corridor was damaged at multiple locations, with more than 32 bridges washed away, severely restricting access to the border region. The destruction also disrupted Nepal-China border trade, tourism, local businesses and emergency access. Communication networks were severely affected, particularly between Timure and Syabrubesi, leaving many affected communities and response agencies isolated.

The disaster also produced major cascading impacts on the energy and critical infrastructure sectors. Preliminary Nepal Electricity Authority information indicated that 748 MW of hydropower capacity was affected, comprising 354 MW from operational projects and 394 MW from projects under construction. Several hydropower facilities, including Rasuwagadhi, Chilime and Trishuli-3A, were reported damaged, along with associated transmission and distribution infrastructure. The 220 kV Trishuli 3B Hub Substation was completely destroyed, while multiple transmission lines were disrupted. These losses affected electricity generation, transmission and distribution beyond the immediate flood corridor. The combined destruction of roads, bridges, customs infrastructure, hydropower facilities, communications and commercial centres demonstrates that the event developed into a multi-sector cascading disaster, in which a sudden source-area disturbance propagated through a highly exposed mountain corridor and produced simultaneous impacts on human settlements, border trade, transport, energy, tourism, communications and emergency-response capacity.

Emergency Response and Rescue Operations

- **Government response activated:** The Government of Nepal, led by the Office of the Prime Minister and Council of Ministers and NDRRMA, activated multi-agency search, rescue, evacuation, relief and information management.
- **Security forces mobilised:** Nepal Army, Armed Police Force, Nepal Police and Rapid Action Teams were deployed across Rasuwa and downstream districts.
- **Rescue operations:** By the afternoon, the Nepal Army had rescued **25 people** from Timure, Syafru and the Trishuli area of Nuwakot.
- **Air rescue and relief: 14 helicopters**, including six Nepal Army and eight private aircraft, were deployed, with additional aircraft kept on standby.
- **Emergency medical response:** An Army MI-17 carrying an Emergency Medical Rescue Team was sent to Trishuli, while **20 specialist Army doctors, including two surgeons**, were positioned at Maithali Barracks after access to Trishuli Hospital was disrupted.
- **Hospitals on alert:** National Trauma Centre, Bir Hospital and Tribhuvan University Teaching Hospital were placed on high alert.
- **Missing-person information:** Toll-free emergency number **1234** was established for reports of missing, trapped and stranded people.

- **Medical and relief support:** Free treatment was directed for flood victims, while WHO provided medicines and multipurpose tents and supported disease surveillance and public health monitoring.
- **Emergency funds:** **NPR 10 million each** was released to Rasuwa and Nuwakot and **NPR 5 million to Dhading.**
- **Evacuation and shelter:** Displaced households were to be moved to safer locations and provided with food and shelter, with assistance arranged for families of those killed.
- **Critical services:** Restoration of roads, bridges, electricity, telecommunications and drinking water was initiated, alongside planning for reconstruction.
- **Downstream alert:** High alert was maintained along the **Bhotekoshi-Trishuli corridor** through Rasuwa, Nuwakot, Dhading, Gorkha and Chitwan, with riverside communities advised to move to safer ground and avoid risky routes.
- **International support:** **China and India expressed readiness to support Nepal's** rescue and relief operations.
- **Overall priority:** Despite damaged access, communications and electricity, authorities simultaneously continued **search and rescue, evacuation, medical care, damage assessment, relief and restoration of essential services**, prioritising the rescue of missing and stranded people and prevention of further loss of life.

Vulnerability Context and Potential Impacts

Most vulnerable groups

- **Security and border personnel** - APF personnel at the Border Outpost, Nepal Police personnel stationed at three posts, and customs staff at Timure and Rasuwagadhi were particularly exposed because their workplaces were located directly within the flood corridor and the event developed with extremely limited warning.
- **Residents of Timure Bazaar, Syabrubesi and other riverside settlements** - Communities in the upper Bhotekoshi corridor faced exceptionally high exposure because of the sudden onset, high flow velocity and narrow valley, leaving seconds to very limited time for recognition, evacuation and self-protection.
- **Workers and employees associated with Nepal-China border trade** - Customs staff, transport workers, traders, drivers, labourers and other people working around the Timure and Rasuwagadhi trading areas were exposed while performing their daily activities.
- **Hydropower workers and communities around hydropower infrastructure** - Employees and labourers working at hydropower facilities, including the Langtang Khola Hydropower Project, were directly exposed, while communities dependent on these facilities face secondary impacts from damage to generation and transmission infrastructure.
- **Downstream riverside communities** - Populations along the Bhotekoshi-Trishuli corridor in Nuwakot, Dhading, Gorkha and Chitwan remain vulnerable to subsequent flood waves, riverbank erosion, debris movement and secondary landslides and have been advised to move to safer locations.

- **People with limited access to information and communication** - The communication blackout between Timure and Syabrubesi disproportionately increased vulnerability among isolated households, stranded travellers, workers and people requiring emergency assistance.

Potential and observed impacts

- **Substantial loss of life and missing persons** - The rapidly changing casualty figures and large number of people initially reported uncontactable indicate a major human impact, while search and rescue operations continued.
- **Extensive destruction in the upper corridor** - Timure Bazaar, Timure Customs, Rasuwagadhi Customs and nearby security and commercial facilities suffered severe damage, with vehicles and other assets swept away.
- **Major disruption to Nepal-China border connectivity and trade** - Damage to the Betrawati-Rasuwagadhi road corridor, bridges and customs infrastructure has disrupted a strategically important international trade and transport route.
- **Extensive transport infrastructure damage** - Multiple bridges and road sections were washed away or damaged, restricting movement and substantially complicating rescue, relief delivery and subsequent recovery.
- **Power and energy disruption** - Damage to hydropower plants, transmission infrastructure and substations has affected electricity generation and distribution, with implications extending beyond the immediately flooded settlements.
- **Disruption of communications and essential services** - The communication blackout and damage to electricity, roads and other lifelines have increased isolation and constrained emergency response.
- **Tourism and mobility impacts** - Tourists, pilgrims, transport workers and travellers were among those affected or reported out of contact, highlighting the vulnerability of mobile populations who may have limited knowledge of local evacuation routes and hazards.
- **Secondary and cascading hazards** - Further landslides, unstable slopes, additional temporary river blockages, bank erosion, debris deposition and continued fluctuations in downstream river levels may create additional risks even after the main flood wave has passed.
- **Prolonged recovery and livelihood impacts** - Damage to markets, border trade, hydropower, transport, tourism and local businesses is likely to produce economic and livelihood impacts well beyond the immediate emergency period.

Implications for Nepal's Himalayan Risk Management

The Bhotekoshi event demonstrates Nepal's vulnerability to **cascading, transboundary and rapidly evolving Himalayan hazards** that may occur without intense rainfall. Key priorities for strengthening risk management include:

- **Strengthen transboundary, multi-hazard monitoring and data sharing** - Establish near-real-time exchange with China on glacial lakes, snow and ice conditions, landslide and avalanche-prone slopes, temporary river blockages, seismic activity and upstream river

conditions. Integrate these observations with satellite data, discharge and river-level monitoring to detect emerging outburst hazards.

- **Develop source-to-downstream early warning systems** - Move beyond rainfall-based thresholds by integrating seismic, cryospheric, geomorphological and hydrological indicators, including detection of temporary natural dams and sudden changes in upstream conditions. Ensure rapid warnings reach riverside communities, security and customs posts, hydropower facilities and transport operators through redundant communication channels.
- **Strengthen anticipatory action, evacuation and emergency preparedness** - Establish hazard-specific protocols, evacuation routes, safe areas, community drills, sirens and clear triggers for rapid evacuation, supported by aerial reconnaissance, search and rescue and medical response capacity.
- **Apply risk-informed infrastructure and land-use planning** - Assess settlements, customs facilities, hydropower projects, roads and other critical infrastructure against extreme flood, debris flow, landslide and outburst scenarios. Build redundancy through alternative access routes, backup power, satellite communications and decentralized emergency supplies.
- **Integrate climate, cryosphere and disaster risk assessment and learn from the event** - Analyse changing snow and ice conditions, glacier dynamics, rainfall, temperature and slope instability together, and reconstruct the event and warning chain to identify where detection, communication and response can be improved and how much additional warning time could realistically be achieved.

Conclusion

The 26 August 2026 Bhotekoshi flash flood highlights an increasingly recurrent Himalayan hazard pattern in which cryospheric, geomorphological and hydrological processes can combine to produce sudden, destructive floods without intense localized rainfall. Preliminary satellite, hydrometeorological and discharge evidence supports a sequence of ice/rock failure, temporary river blockage, impoundment and sudden outburst, amplified by the steep, narrow river corridor and heavy sediment and debris load. The event reflects the growing interaction of changing snow and ice conditions, unstable slopes and expanding exposure across the Hindu Kush Himalaya.

Although the precise source mechanism, breach dynamics, peak discharge and possible seismic contribution require further investigation, the event demonstrates the limitations of rainfall-dependent flood warning in high mountain environments. It highlights the need for transboundary, multi-hazard monitoring, source-to-downstream early warning, detection of temporary natural dams, real-time river and geomorphic surveillance, reliable last-mile communication, anticipatory evacuation and risk-informed infrastructure planning.

Note: This document presents the preliminary observations using the secondary data available across the online sources- official pages of NDRRMA and Flood Forecasting Unit of the DHM, and media sources such as Gorkhapatra, OnlineKhabar, eKantipur, etc. rather than collecting data directly from the field.